

Type Coffee Vending Machine	Model 9100	N° T.I. 10 - 2018
Serial Number 82310434	Subject CHANGE OF the 10" TOUCH SCREEN CARRIER BOARD	ISSUED FOR (X) Action Information X

REASON:


It is reported that in some case the internal battery of the carrier board, inserted in the 10" touchscreen, has been discharged prematurely.

MODIFICATIONS:

A *pin* of the *U30* component, that it has been never used, is the root cause of the premature battery discharge.

So the *pin* has been disconnected by the touch screen supplier.

U30 component

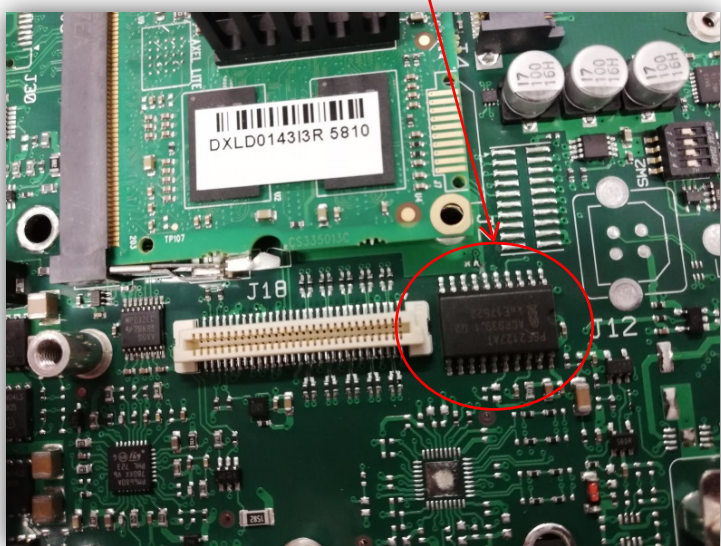

➤ **Machines concerned by modification from S/N 82310434.**

EXCHANGEABILITY:

The **new** solution can be fitted on machines previous to above S/N.

The spare code of "**10" touch screen assembly**" is not changed: **260321**