

<b>T.I. no.: 2017 - 08</b> Updated: -	<b>Topic: Schaerer Barista Software 1.5.3</b>
--	---

<b>Date: 08.06.2017</b>	<b>Priority</b>	<b>Need for action</b>
<b>Affected machines: Schaerer Barista</b>	High	As soon as possible
<b>From serial number: -</b>	X Medium	X On next visit to the machine
<b>As of date: -</b>	Low	FYI only

## Portioning adjustment

Portioning adjustment cannot be run completely with software version 1.5.1. The routine terminates and the machine has to be restarted.

The method which led to the "Grinder blocked" error message has been revised in software version 1.5.1. It was determined that the grinder motor can overheat during long periods of grinding without a break, such as during the portioning adjustment routine. In this case, the internal temperature protection system of the grinder motor terminates the routine.

With version 1.5.3, a break of 5 seconds has been integrated between the individual grinding cycles in order to prevent the grinder motor from overheating.

### Important technical note:

If the portioning adjustment terminates even though the software is current, let the grinder cool for about 5 minutes before the routine is restarted.

## Note on descaling

Boiler descaling cannot be run in machines with software versions 1.4.2 and 1.4.3.

The machines must be updated to software version 1.5.3 to execute boiler descaling and to be able to use the improved pressure reduction routine.

(EN) This page is intentionally left blank.

(DE) Diese Seite wurde absichtlich frei gelassen.

(FR) Cette page est laissée vide intentionnellement.

(ES) Esta página se dejado en blanco intencionalmente.