



Type Coffee Vending Machine	Model 9100 IN	T.I. NO 06 - 2017	
Serial Number 72412398	Subject NEW MIXER ASSEMBLY	ISSUED	Action
		FOR (X)	Information X

REASON:

Be informed that with the aim to improve our equipment, a **new Mixer Assembly** has been introduced. It guarantees a better watertight seal, that avoids any motor mixer breakage due to any possible leakage. Moreover the removal and the replacement of the *mixer funnel* is now easier.

MODIFICATIONS:

1. **V-Ring (A)** replaced by **bush-seal (A)** – see below and next page.
2. **Flange + forced brass bush (B)** replaced by **new flange (B)** (see next page).
3. **Assembly (C) mixer whisk + casing + O-R** replaced by **new Assembly mixer whisk + casing (C)**
4. **Mixer fan (whisk shaft D. 6 mm) (D)** replaced by **new mixer fan (whisk shaft D. 4 mm) (D)**
5. **O-Ring seal for mixer-flange (E)** replaced by **new seal (E)**.

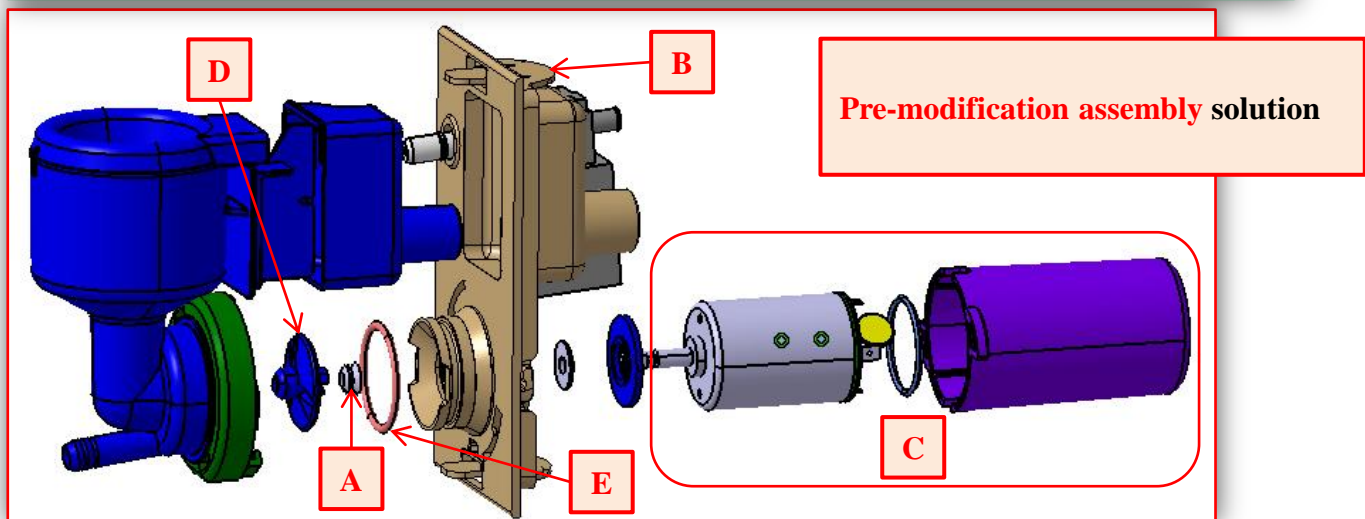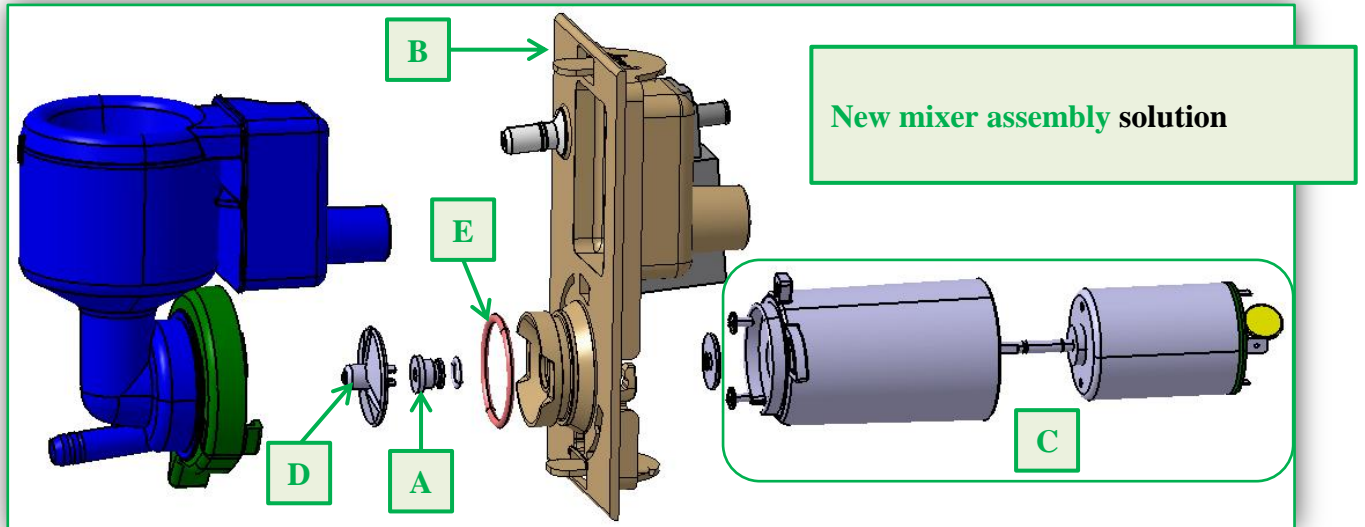


TECHNICAL INFORMATION JDE



Type Coffee Vending Machine	Model 9100 IN	T.I. NO 06 - 2017	
Serial Number 72412398	Subject NEW MIXER ASSEMBLY	ISSUED FOR (X)	Action Information X

1.

New solution: bush seal + gasket OR

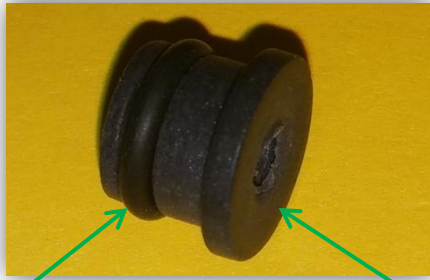

Spare code: **0V0775**

Spare code: **097917**

Pre-modification solution: V-Ring



Spare code: **259612**

2.

New solution: Flange without bush



Spare code: **260793**

Pre-modification solution: Flange + bush assembly



Spare code: **256075**

Type Coffee Vending Machine	Model 9100 IN	T.I. NO 06 - 2017	
Serial Number 72412398	Subject NEW MIXER ASSEMBLY	ISSUED FOR (X)	Action Information X

3.

New solution

Assembly: *mixer whisk + casing*



Mixer whisk bush
Spare: **260792**


New mixer whisk

(shaft D.4 mm)
Spare : **260795**



New mixer whisk casing

Spare: **260794**

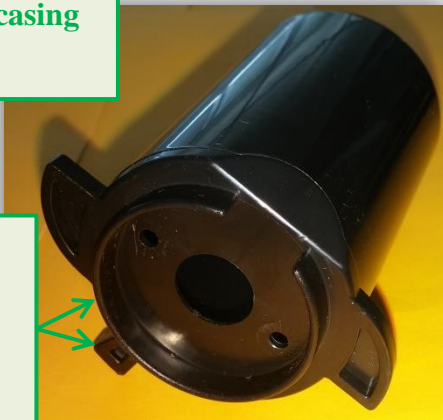

Crown and sprocket added to improve the fixing to the Flange


Pre-modification solution

Assembly: *mixer whisk + casing + O-R*



O-Ring blue
Spare: **39400642**


Mixer whisk (shaft D. 6 mm)
Spare code: **41534900**

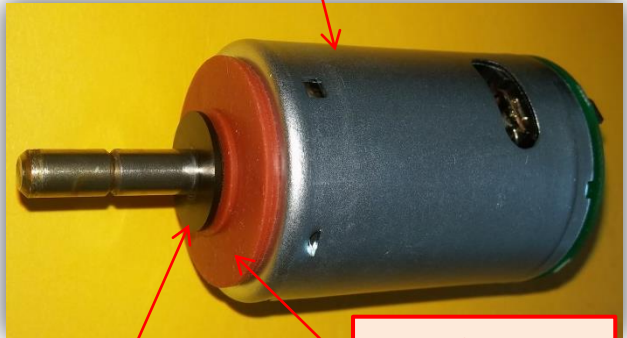

Mixer whisk bush
Spare: **39733800**

Whisk seal
Spare: **39594500**

Mixer whisk casing
Spare: **39590300**

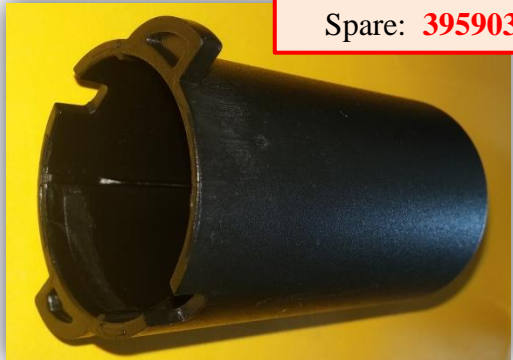


Type Coffee Vending Machine	Model 9100 IN	T.I. NO 06 - 2017	
Serial Number 72412398	Subject NEW MIXER ASSEMBLY	ISSUED FOR (X)	Action Information X

4.

New mixer fan

Spare code: **260109**

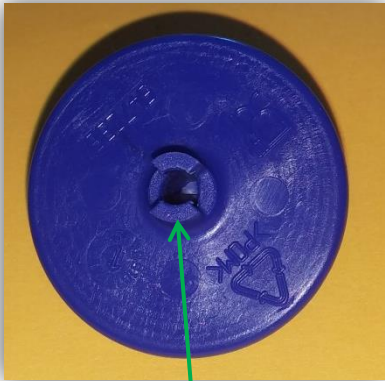

Whisk shaft D. **4 mm**

Pre-modification mixer fan

Spare code: **39590002**



Whisk shaft D. **6 mm**

5.

New mixer seal

Spare code: **261256**



Pre-modification: O-Ring

Spare code: **0V0776**



Thanks to the **new seal** the removal and the replacement of the mixer funnel is now easier.

TECHNICAL INFORMATION JDE

Type Coffee Vending Machine	Model 9100 IN	T.I. NO 06 - 2017	
Serial Number 72412398	Subject NEW MIXER ASSEMBLY	ISSUED	Action
		FOR (X)	Information X

Machines concerned by modification from S/N 72412398

EXCHANGEABILITY:

Important note: the **new mixer assembly** can not be used for machines previous to serial number above.

➤ Below the **codes** affected by the modification:

New solution: bush seal

097917 SAP 55001684

New solution: O-Ring

0V0775 SAP 55117530

New mixer Flange

260793 SAP 55117890

New mixer whisk Spare

260795 55117891

New mixer whisk casing

260794 SAP 55117892

New mixer whisk bush

260792 55117893

New mixer fan

260109 SAP 55117894

New mixer seal

261256 55117895

Pre-modif. solution: V-Ring

Spare code: **259612**

Pre-modification Flange + bush

Spare code: **256075**

Pre-modification mixer whisk

Spare code: **41534900**

Pre-modification mixer whisk casing

Spare code: **39590300**

Pre-modification mixer whisk bush

Spare code: **39733800**

Pre-modification mixer whisk seal

Spare code: **39594500**

Pre-modification whisk O-Ring

Spare code: **39400642**

Pre-modification mixer fan

Spare code: **39590002**

Pre-modification mixer seal

Spare code: **0V0766**