

Type Coffee Vending Machine	Model KORO PRIME	N° T.I. 11 - 2018
Serial Number 84611149	Subject CHANGE of AIR – BREAK OVERFLOW	ISSUED FOR (X) Action Information X

REASON:

Be informed that with the aim to improve the hydraulic circuit performance.
This to avoid water inlet blocking and in some cases coffee taste on hot water.


MODIFICATIONS:

the *overflow draining* branch of the *air - break* has been changed as shown below.
The modification will avoid that possible drops of coffee, coming from the discharge branch of the third Espresso solenoid valve way, can be traced back to the air-break

New solution

Detail of hydraulic circuit

3rd way of ES Valve

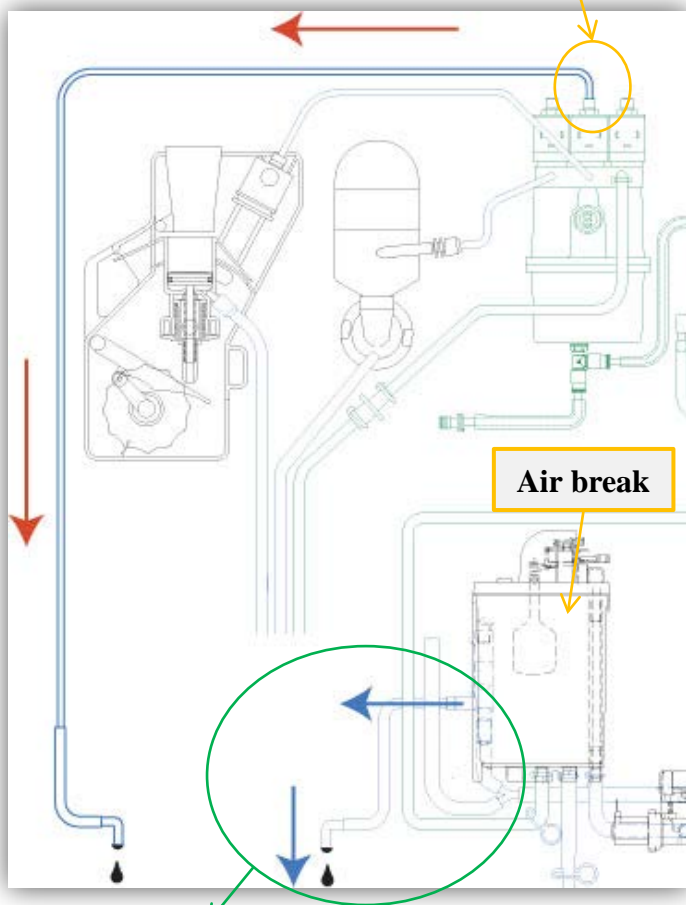


New overflow draining branch is separated from the **output** of the third ES valve

Pre-modification solution

Detail of hydraulic circuit

3rd way of ES Valve

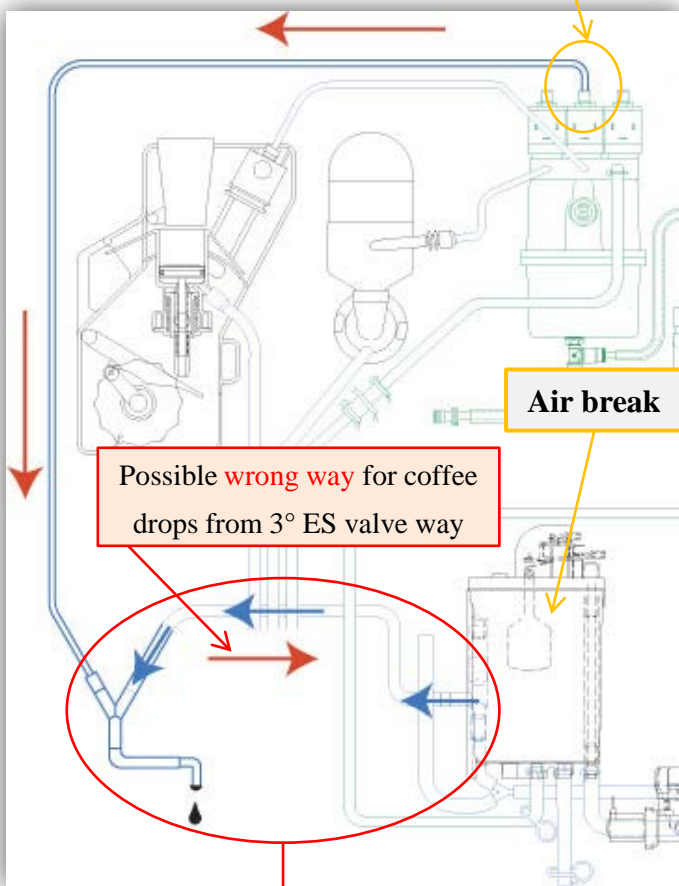

Pre-modification overflow draining branch is connected to the **output** of the third ES valve


Type Coffee Vending Machine	Model KORO PRIME	N° T.I. 11 - 2018
Serial Number 84611149	Subject CHANGE of AIR – BREAK OVERFLOW	ISSUED FOR (X) Action Information X

New solution

A **hole** has been added on the metal cover to allow the passage of the hose



Overflow draining branch of air - break

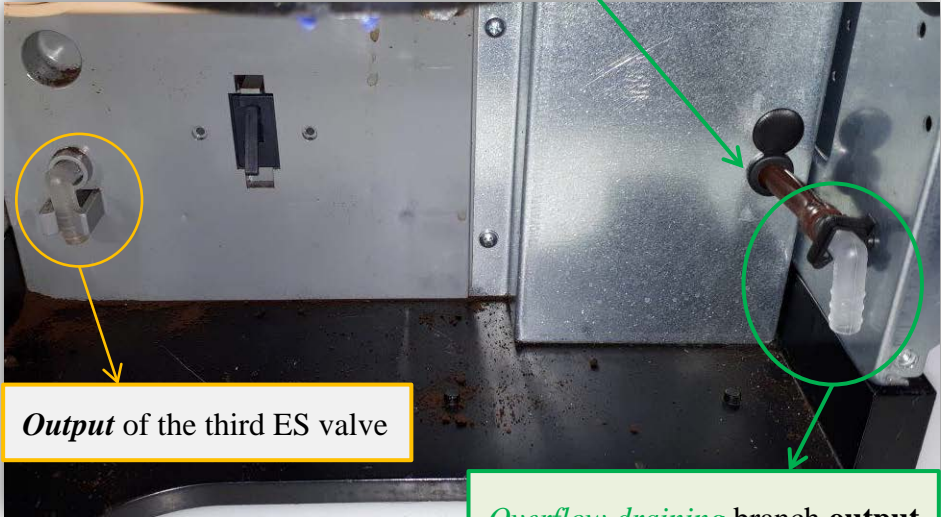

Output of the third ES valve

Overflow draining branch output

➤ Machines concerned by modification from S/N **84611149**