

<b>T.I. no.:</b> 2020 - 19 <b>Updated:</b> -	<b>Topic:</b> SC Club – Product optimisation hose routing
---	---


<b>Date:</b> 17/6/2020	<b>Priority</b>	<b>Need for action</b>
<b>Affected machines:</b> Schaerer Coffee Club	High	As soon as possible
<b>From serial number:</b> -	X Medium	X On next visit to the machine
<b>As of date:</b> From production 06/2020	Low	FYI only

## OPTIMISATION HOSE ROUTING

In the following please find the documentation about a product optimisation already introduced in series production in order to avoid damaged hoses.

Due to individual reports from the field, an additional edge protection was fitted to the plastic support of the coffee grinder in order to prevent possible damage to nearby hoses.

The edge protection is installed on machines after production date 06.2020.

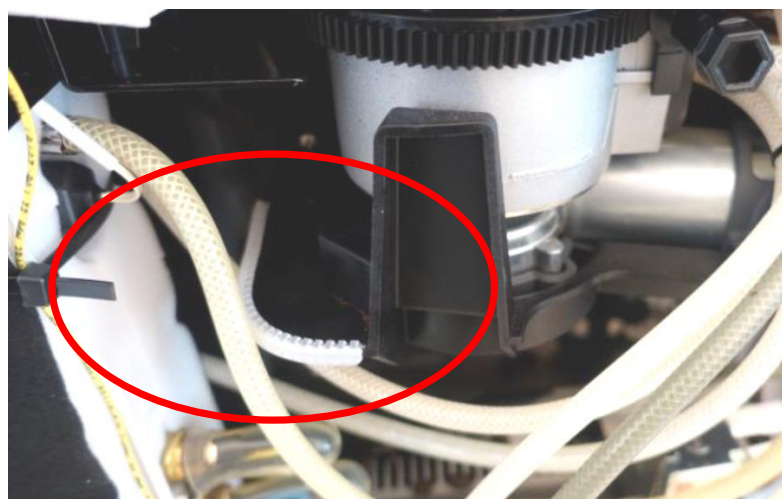

## Advice for technicians

The edge protection can be retrofitted without any problems and can be ordered by meter with the following item number:

- 00.0048.0090 edge protection PE natural
- per machine 10 cm edge protection is required

We recommend retrofitting the edge protection during the next service visit on machines in the field. If a hose is already damaged, replace the hose in order to avoid possible subsequent problems.