

Type Coffee Vending Machine	Model 9100	N° T.I. 02 - 2020
Serial Number 94511620	Subject NON-RETURN VALVE INTEGRATED with BY-PASS	ISSUED FOR (X) Action Information <input checked="" type="checkbox"/>

REASON:

Be informed that with the aim to improve and standardize our equipment

MODIFICATIONS:

A **new non-return valve**, integrated with a **by-pass**, has been introduced. The new valve is made of polyamide.

New solution
Non-Return Valve + BY-PASS integrated

Pre-modification solution
Non-Return Valve + BY-PASS separated



New **"non-Return Valve + BY-PASS"** integrated
Spare code: **257729 sap: 55120060**


➤ **Machines concerned by modification from S/N 94511620**

Type Coffee Vending Machine	Model 9100	N° T.I. 02 - 2020
Serial Number 94511620	Subject NON-RETURN VALVE INTEGRATED with BY-PASS	ISSUED FOR (X) Action Information X

Important note: for machines prior to above S/N, it's possible to implement the **"Non-Return Valve + BY-PASS integrated"** by ordering the **hose assembly (1)** and the **OR gasket (2)**.

1

New **hose assembly** for *non-return valve* - Spare code: **262051** sap: **55121774**

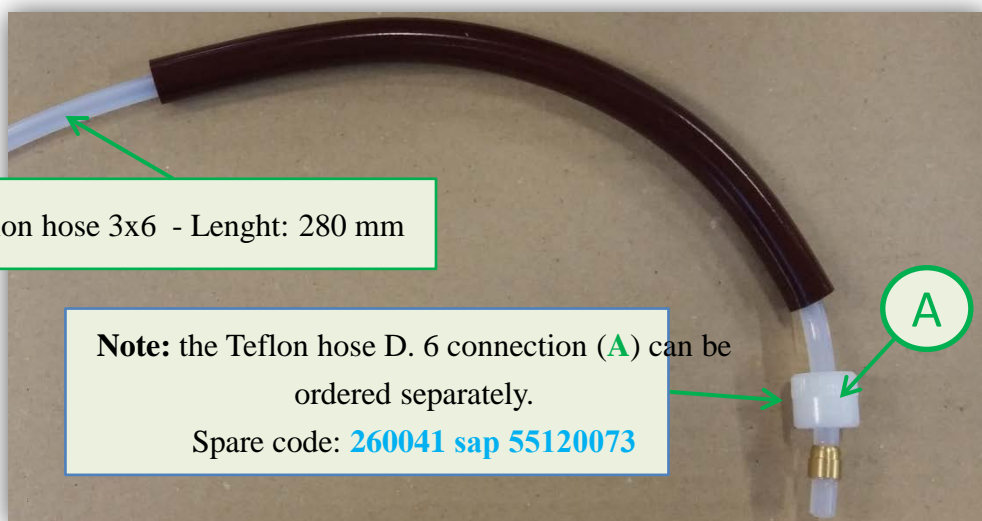

Teflon hose 3x6 - Length: 280 mm


Note: the Teflon hose D. 6 connection (A) can be ordered separately.
Spare code: **260041** sap **55120073**

2 : Gasket OR 1,5 x 5,5 Spare code: **260042** sap **55120061**



➤ ➔ **Pre-modification solution**

Non-return valve
Spare code: **099101**

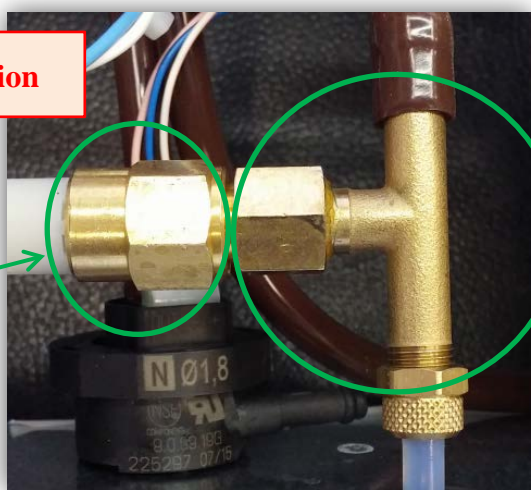

By-Pass pump 12 bar
Spare code: **098764**