

Type <b>Coffee Vending Machine</b>	Model <b>9100 IN - 9200 CV</b>	N° T.I. <b>03 - 2020</b>
Serial Number <b>00721964</b>	Subject <b>INSTANT BOILER ASSEMBLY MODIFICATIONS</b>	ISSUED FOR (X) Action Information <input checked="" type="checkbox"/>

**REASON:**

To avoid any boiler assembly hose from detaching and causing a water spill


**MODIFICATIONS:**

- Three hose clips** have been added on the hoses coming out from the instant boiler
- The pre-modification brown silicone hose**, connecting the instant boiler to the pump, has been replaced by a transparent silicone hose, plus a fitting and a shorter brown silicone hose.

**Modification 1**

**New solution**

boiler body + 3 hoses + **3 hose clips**

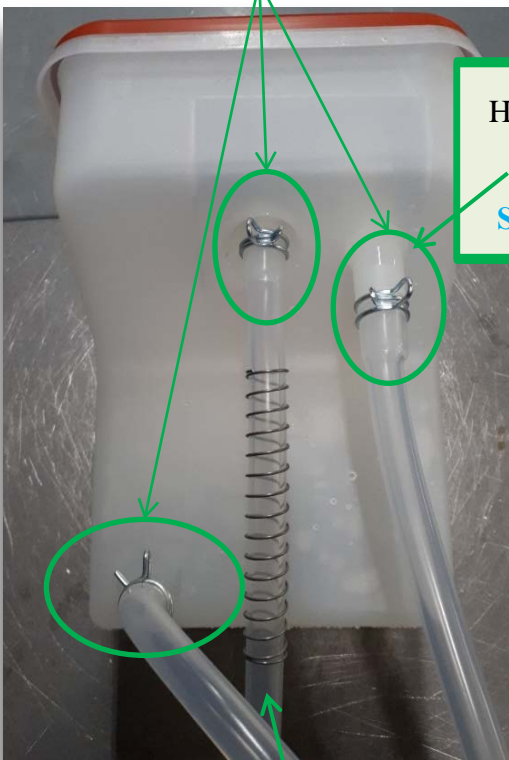

Hose clip Spare:

**096264**

**SAP 55114073**

**Pre-modification solution**

boiler body + 3 hoses



No hose clips

**Modification 2**

**Transparent silicone hose**  
replacing the **brown one**


Length: **260 mm** Spare: **255541**  
**SAP: 55100922**

**Pre-modification brown silicone hose**




Type <b>Coffee Vending Machine</b>	Model <b>9100 IN - 9200 CV</b>	N° T.I. <b>03 - 2020</b>
Serial Number <b>00721964</b>	Subject <b>INSTANT BOILER ASSEMBLY MODIFICATIONS</b>	ISSUED FOR (X) Action Information <b>X</b>


**New solution**  
Instant boiler assembly

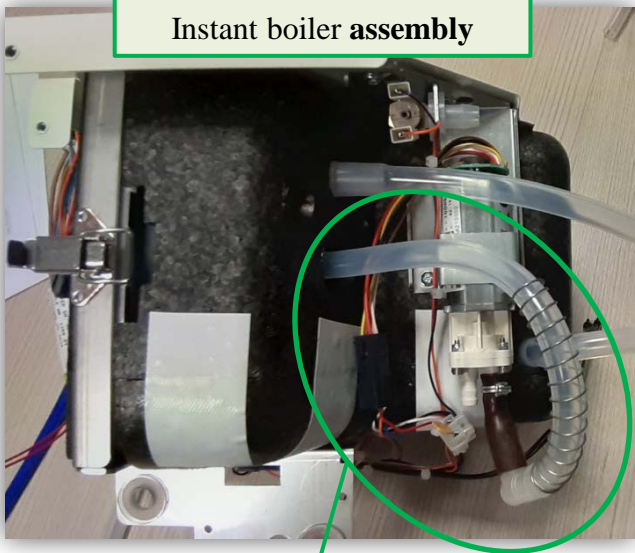

**Pre-modification solution**  
Instant boiler assembly

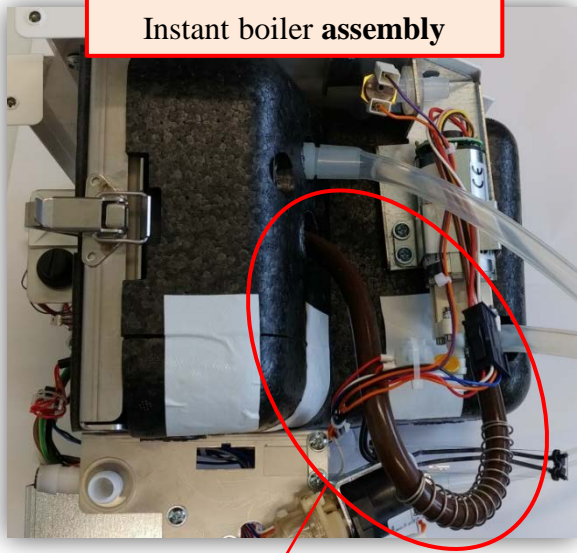


**Modification 2**

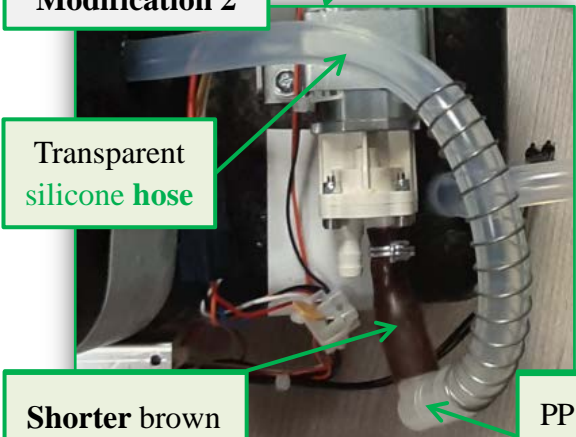

Transparent silicone hose

Shorter brown silicone hose (40 mm)  
Spare: **097685**  
SAP: **55001674**

PP elbow fitting  
Spare: **39758800**  
SAP: **55102011**

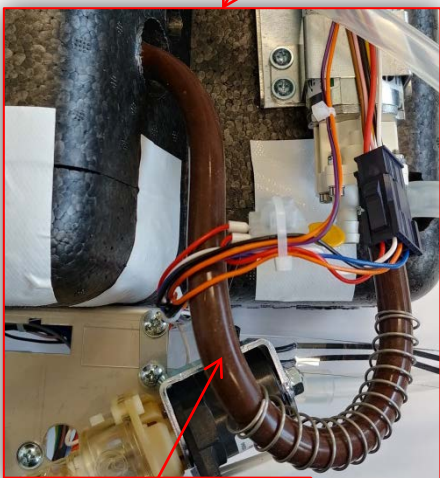

Pre-modification brown silicone hose

The instant boiler assembly spare code is not changed: **260784**

➤ Machines concerned by modification from S/N: **00721964**

**EXCHANGEABILITY:**

For machines previous to above S/N it si possible to use the **new** instant boiler assembly